


# 2. GENERAL INFORMATION

## SC10AS WIRING DIAGRAM

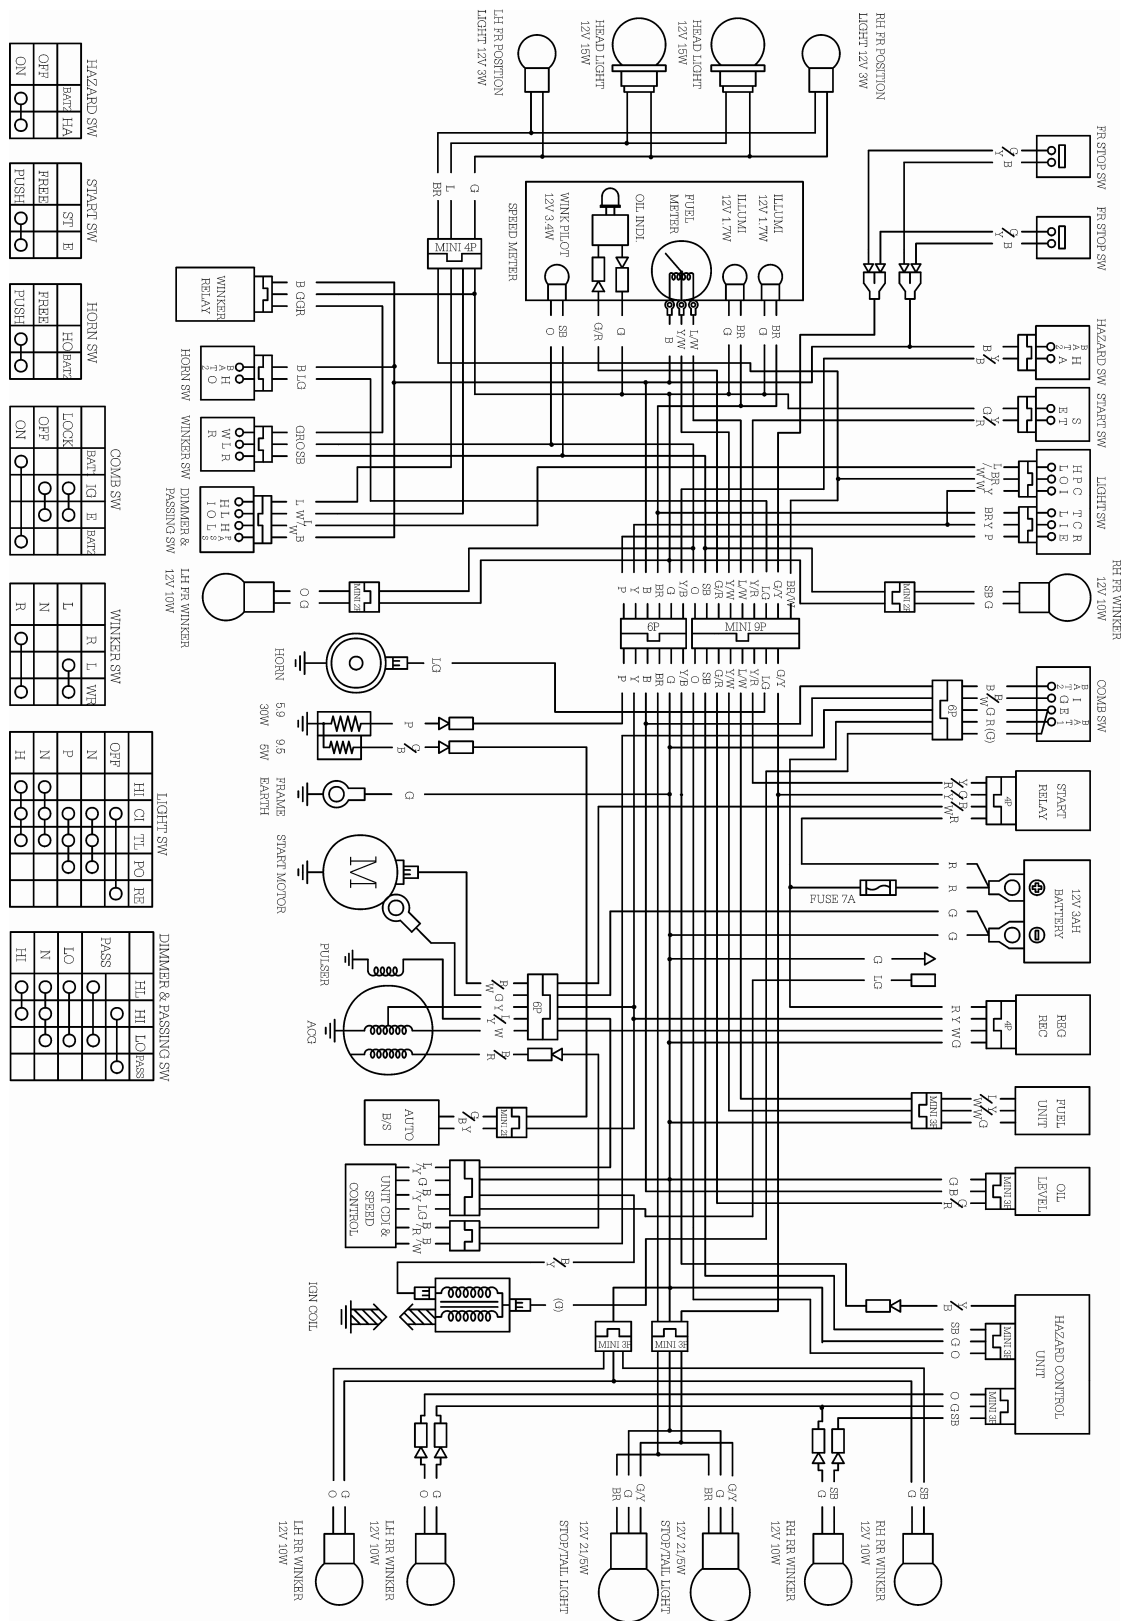

HAZARD SW	BAZ	HA
OFF	ON	ON

START SW	ST	E
FREE	PUSH	ON

HORN SW	HQ	BAT
FREE	PUSH	ON

COMB SW	BAT	IG	E	BAT
LOCK	ON	ON	ON	ON
OFF	ON	ON	ON	ON

WINKER SW	R	L	WF
ON	ON	ON	ON
OFF	ON	ON	ON

LIGHT SW	HI	CI	TL	PO	RE
OFF	ON	ON	ON	ON	ON
ON	ON	ON	ON	ON	ON

DIMMER & PASSING SW	HI	HI	LO	PASS
ON	ON	ON	ON	ON
OFF	ON	ON	ON	ON